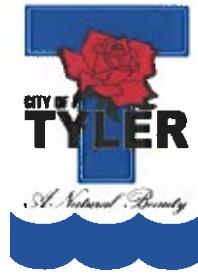


P. O. Box 2039
Tyler, Texas 75710



511 W. Locust
Tyler, Texas 75702

13 April 2021

Associate Director, Water Enforcement Branch
Compliance Assurance and Enforcement Division
U.S. Environmental Protection Agency, Region 6
1201 Elm Street, Suite 500
Dallas, TX 75270-2102

James Sallans
Litigation Division, MC-175
Texas Commission on Environmental Quality
P.O. Box 13087
Austin, TX 78711-3087

Re: City of Tyler Consent Decree
DOJ No. 90-5-1-09767
Quarterly Report – 2021 Quarter 1 (January – March)

To EPA Region 6 and TCEQ:

Pursuant to Paragraph IX.87 of the Consent Decree for *United States et al v. City of Tyler*, please find enclosed electronic and hard copies of the City of Tyler's quarterly report covering the time period of 1 January 2021 through 31 March 2021.

Please do not hesitate to contact me at (903) 531-1085 if you have any questions.

Sincerely,

Paul Neuhaus, M.S., P.E.
Environmental Compliance Engineer

Enclosures

City of Tyler
Consent Decree, DOJ No. 90-5-1-1-09767
Quarterly Report - 2021 Quarter 1
01 January 2021 through 31 March 2021

Start Date	Start Time	End Date	End Time	Address/Location	Asset ID	Receiving Stream	Estimated Volume Discharged (gal)	Estimated Volume Recovered (gal)	Component from Which SSO Was Released	Suspected Cause of SSO	Potential Danger to Human Health & Safety or the Environment	Repeat SSO? If yes, list date(s) of previous SSO(s) at this address/asset	Comments/Response	Follow-Up Actions	Public Notification Made?
1/5/2021	1:00:00 PM	1/5/2021	5:00:00 PM	15698 CR 46, Tyler, TX, 75704	SS.FM.T0000010	Contained In Yard	2400	2400	FORCE MAIN	BREAKS, OTHER CAUSES	No	Yes - 2/6/2020	Sewer leaking out of manhole. SS.MH.0000233 was leaking approximately 10 gallons per minute for 240 minutes = 2400 gallons into yard. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 2,900 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main	No
1/6/2021	2:53:00 PM	1/6/2021	3:05:15 PM	W Gentry Pkwy & N Palace Ave, Tyler, TX, 75702	SS.GM.T0005577	Blackfork Creek	120	0	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0004569 was leaking approximately 10 gallons per minute for 12 minutes = 120 gallons into storm drain. Stop was approximately 50 feet from SS.MH.T0003013. Area was flushed with 420 gallons of fresh water, and disinfected with HTH. Recovered 0 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/7/2021	9:54:00 AM	1/7/2021	10:15:00 AM	305 S Hill Ave, Tyler, TX, 75702	SS.GM.T0007140	Willow Creek	420	420	MANHOLE	DEBRIS FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0001847 was leaking approximately 20 gallons per minute for 21 minutes = 420 gallons into storm drain. Stop was relieved from SS.MH.T0001836 by running South for 83 feet. Area was flushed with 1,500 gallons of fresh water, and disinfected with HTH. Recovered 1,920 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/7/2021	1:00:19 PM	1/7/2021	2:00:25 PM	3707 Wynnwood Dr, Tyler, TX, 75701	SS.GM.T0000703	West Mud Creek	375	375	PRIVATE CLEANOUT	DEBRIS	No	Yes - 4/21/2018 & 2/29/2020	Sewer leaking out of private cleanout. The private cleanout was leaking approximately 5 gallons per minute for 75 minutes = 375 gallons into West Mud Creek. Stop was relieved from SS.MH.T0005227 by running North for 25 feet. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 875 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/12/2021	2:25:33 PM	1/12/2021	3:25:00 PM	Bellwood Rd & Buckley Ave, Tyler, TX, 75701	SS.GM.T0007749	Indian Creek	60	60	MANHOLE	DEBRIS FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0002095 was leaking approximately 1 gallons per minute for 60 minutes = 60 gallons into storm drain. Stop was relieved from SS.MH.T0002099 by running East for 700 feet. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 560 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/13/2021	2:15:00 PM	1/13/2021	3:30:00 PM	2695 S Southwest Loop 323, Tyler, TX, 75701	SS.GM.T0012724	Contained In Yard	750	750	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0012724 was leaking approximately 10 gallons per minute for 75 minutes = 750 gallons into yard. Stop was relieved from SS.MH.T0001390 by running South for 226 feet. Area was flushed with 2,000 gallons of fresh water, and disinfected with HTH. Recovered 750 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/20/2021	11:22:00 AM	1/20/2021	12:00:00 PM	Idel St & S Fleishel Ave, Tyler, TX, 75701	SS.GM.T0004774	Blackfork Creek	494	494	MANHOLE	DEBRIS	No	No	Sewer leaking out of manhole. SS.MH.T0004774 was leaking approximately 13 gallons per minute for 38 minutes = 494 gallons into Black Fork Creek. Stop was relieved from SS.MH.T0000560 by running South for 475 feet. Area was flushed with 3,000 gallons of fresh water, and disinfected with HTH. Recovered 3,494 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No

City of Tyler
Consent Decree, DOJ No. 90-5-1-1-09767
Quarterly Report - 2021 Quarter 1
01 January 2021 through 31 March 2021

Start Date	Start Time	End Date	End Time	Address/Location	Asset ID	Receiving Stream	Estimated Volume Discharged (gal)	Estimated Volume Recovered (gal)	Component from Which SSO Was Released	Suspected Cause of SSO	Potential Danger to Human Health & Safety or the Environment	Repeat SSO? If yes, list date(s) of previous SSO(s) at this address/asset	Comments/Response	Follow-Up Actions	Public Notification Made?
1/27/2021	11:30:10 AM	1/27/2021	12:30:15 PM	2441 Sunnybrook Dr, Tyler, TX, 75701	SS.GM.T0003021	Contained In Storm Drain	80	80	MANHOLE	BREAKS, OTHER CAUSES DEBRIS	No	No	Sewer leaking out of manhole. SS.MH.T0003950 was leaking approximately 2 gallons per minute for 40 minutes = 80 gallons into storm drain. Stop was relieved from SS.MH.T0002479 by running South for 112 feet. Area was flushed with 200 gallons of fresh water, and disinfected with HTH. Recovered 280 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, Repair Sewer Main, CCTV	No
1/27/2021	3:00:00 PM	1/27/2021	4:30:00 PM	2323 Frankston Hwy, Tyler, TX, 75701	SS.GM.T0002539	Contained In Storm Drain	450	450	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0002416 was leaking approximately 5 gallons per minute for 90 minutes = 450 gallons into storm drain. Stop was relieved from SS.MH.T0002415 by running west for 149 feet. Area was flushed with 1000 gallons of fresh water, and disinfected with HTH. Recovered 1,450 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
1/27/2021	11:55:00 AM	1/27/2021	1:30:00 PM	3326 Craftdale Dr, Tyler, TX, 75701	SS.GM.T0006448	Contained In Yard	35	35	PRIVATE CLEANOUT	DEBRIS	No	No	Sewer leaking out of private cleanout. Cleanout was leaking approximately 1 gallons per minute for 35 minutes = 35 gallons into yard. Area was flushed with 200 gallons of fresh water, and disinfected with HTH. Recovered 235 gallons of wash water, disinfectant, and sewer mixture.	PM Wash, CCTV	No
2/1/2021	7:30:06 AM	2/1/2021	11:00:12 AM	Shelley Dr & S Broadway Ave, Tyler, TX, 75701	SS.GM.T0003827	Contained In Storm Drain	150	150	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0005170 was leaking approximately 2 gallons per minute for 75 minutes = 150 gallons into storm drain. Area was flushed with 700 gallons of fresh water, and disinfected with HTH. Recovered 850 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list	No
2/2/2021	8:15:00 AM	2/2/2021	9:00:00 AM	2616 W Northwest Loop 323, Tyler, TX, 75702	SS.GM.T0012349	Contained In Storm Drain	45	45	MANHOLE	DEBRIS	No	No	Sewer leaking out of manhole. SS.MH.T0000258 was leaking approximately 1 gallons per minute for 45 minutes = 45 gallons into storm drain. Area was flushed with 200 gallons of fresh water, and disinfected with HTH. Recovered 245 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list	No
2/9/2021	11:09:00 AM	2/9/2021	12:03:00 PM	1224 Winona Ave, Tyler, TX, 75702	SS.GM.T0008420	Blackfork Creek	216	216	GRAVITY MAIN	BREAKS, OTHER CAUSES	No	No	Sewer leaking out of gravity main. SS.GM.T0008420 was leaking approximately 4 gallons per minute for 54 minutes = 216 gallons into Black Fork Creek. Area was flushed with 9,000 gallons of fresh water, and disinfected with HTH. Recovered 9,216 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main, CCTV	No
2/19/2021	7:00:00 PM	2/20/2021	9:00:02 PM	838 S Fleishel Ave, Tyler, TX, 75701	SS.GM.T0004790	Contained In Storm Drain	240	240	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0005083 was leaking approximately 2 gallons per minute for 120 minutes = 240 gallons into storm drain. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 740 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No
2/20/2021	4:30:58 PM	2/20/2021	6:30:03 PM	1827 Ricketty Ln, Tyler, TX, 75703	SS.GM.T0001224	Contained In Yard	120	120	PRIVATE CLEANOUT	DEBRIS	No	No	Sewer leaking out of private cleanout. Private clean-out was leaking approximately 1 gallons per minute for 120 minutes = 120 gallons into yard. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 620 gallons of wash water, disinfectant, and sewer mixture.	PM Wash	No

City of Tyler
Consent Decree, DOJ No. 90-5-1-1-09767
Quarterly Report - 2021 Quarter 1
01 January 2021 through 31 March 2021

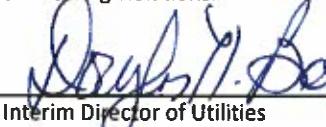
Start Date	Start Time	End Date	End Time	Address/Location	Asset ID	Receiving Stream	Estimated Volume Discharged (gal)	Estimated Volume Recovered (gal)	Component from Which SSO Was Released	Suspected Cause of SSO	Potential Danger to Human Health & Safety or the Environment	Repeat SSO? If yes, list date(s) of previous SSO(s) at this address/asset	Comments/Response	Follow-Up Actions	Public Notification Made?
3/2/2021	9:34:00 AM	3/2/2021	10:15:00 AM	2500 Walton Rd, Tyler, TX, 75701	SS.GM.T0007257	Contained In Storm Drain	41	41	MANHOLE	BREAKS, OTHER CAUSES	No	No	Sewer leaking out of manhole. SS.MH.T0001210 was leaking approximately 1 gallon per minute for 41 minutes = 41 gallons into storm drain. Stop was relieved from SS.MH.T0001193 by running south for 353 feet. Area was flushed with 300 gallons of fresh water, and disinfected with HTH. Recovered 341 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main, CCTV	No
3/4/2021	2:00:00 PM	3/4/2021	2:15:00 PM	310 N Beverly Ave, Tyler, TX, 75702	SS.GM.T0004844	Contained In Storm Drain	15	15	PRIVATE CLEANOUT	FATS, OIL, GREASE	No	Yes - 4/5/2017 & 12/27/2017	Sewer leaking out of private cleanout. Private clean-out was leaking approximately 1 gallon per minute for 15 minutes = 15 gallons into storm drain. Area was flushed with 200 gallons of fresh water, and disinfected with HTH/lime. Recovered 215 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No
3/5/2021	1:30:00 PM	3/5/2021	1:45:00 PM	3031 W Gentry Pkwy, Tyler, TX, 75702	SS.GM.T0005934	Blackfork Creek	75	75	GRAVITY MAIN	BREAKS, OTHER CAUSES	No	Yes - 7/24/2020	Sewer leaking out of gravity main. SS.GM.T0005934 was leaking approximately 5 gallons per minute for 15 minutes = 75 gallons into Black Fork Creek. Area was flushed with 15,000 gallons of fresh water, and disinfected with HTH. Recovered 15,075 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main	No
3/7/2021	5:40:00 PM	3/7/2021	7:10:00 PM	2417 Plume Dr, Tyler, TX, 75703	SS.GM.T0003578	Contained in Yard	90	0	PRIVATE CLEANOUT	ROOTS	No	No	Sewer leaking out of private cleanout. Private clean-out was leaking approximately 1 gallon per minute for 90 minutes = 90 gallons into yard. Recovered 0 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No
3/9/2021	12:42:00 PM	3/9/2021	5:15:00 PM	Medical Dr, Tyler, TX, 75701	SS.GM.T0009245	Blackfork Creek	8190	8,190	GRAVITY MAIN	BREAKS DUE TO EROSION ROOTS	No	No	Sewer leaking out of gravity main. SS.GM.T0009245 was leaking approximately 30 gallons per minute for 273 minutes = 8,190 gallons into Black Fork Creek. Area was flushed with 72,000 gallons of fresh water, and disinfected with HTH. Recovered 26,500 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main, CCTV	No
3/10/2021	1:00:14 PM	3/10/2021	3:00:47 PM	415 Powell Dr, Tyler, TX, 75703	SS.GM.T0001621	West Mud Creek	360	360	MANHOLE	BREAKS DUE TO EROSION	No	No	Sewer leaking out of manhole. SS.MH.T0005481 was leaking approximately 3 gallons per minute for 120 minutes = 360 gallons into West Mud Creek. Area was flushed with 1,000 gallons of fresh water, and disinfected with HTH. Recovered 1,360 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main, CCTV	No
3/15/2021	12:45:07 PM	3/15/2021	1:50:14 PM	3931 Troup Hwy, Tyler, TX, 75703	SS.GM.T0001742	West Mud Creek	650	650	MANHOLE	FATS, OIL, GREASE	No	Yes - 2/20/2018	Sewer leaking out of manhole. SS.MH.T0005585 was leaking approximately 5 gallons per minute for 130 minutes = 650 gallons into West Mud Creek. Stop was relieved from SS.MH.T0005583 by running East for 164 feet. Area was flushed with 1,000 gallons of fresh water, and disinfected with HTH. Recovered 1,650 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No
3/19/2021	3:45:00 PM	3/19/2021	4:30:00 PM	1420 Old Noonday Rd, Tyler, TX 75701	SS.GM.T0009316	Contained In Yard	225	0	MANHOLE	DEBRIS, GREASE	No	Yes - 8/3/2017	Sewer leaking out of manhole. SS.MH.T0005997 was leaking approximately 5 gallons per minute for 45 minutes = 225 gallons into yard. Area was flushed with 1,000 gallons of fresh water, and disinfected with HTH. Recovered 0 gallons of wash water, disinfectant, and sewer mixture.	Placed on HFCP Root Control list	No


City of Tyler
Consent Decree, DOJ No. 90-5-1-09767
Quarterly Report - 2021 Quarter 1
01 January 2021 through 31 March 2021

Start Date	Start Time	End Date	End Time	Address/Location	Asset ID	Receiving Stream	Estimated Volume Discharged (gal)	Estimated Volume Recovered (gal)	Component from Which SSO Was Released	Suspected Cause of SSO	Potential Danger to Human Health & Safety or the Environment	Repeat SSO? If yes, list date(s) of previous SSO(s) at this address/asset	Comments/Response	Follow-Up Actions	Public Notification Made?
3/23/2021	2:03:00 PM	3/23/2021	2:35:00 PM	1327 Baxter Ave, Tyler, TX 75701	SS.GM.T0004802	Contained In Storm Drain	32	32	MANHOLE	DEBRIS	No	No	Sewer leaking out of manhole. SS.MH.T0003203 was leaking approximately 1 gallon per minute for 32 minutes = 32 gallons into storm drain. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 532 gallons of wash water, disinfectant, and sewer mixture.	PM Wash	No
3/24/2021	11:30:43 AM	3/24/2021	12:07:48 PM	415 Powell Dr, Tyler, TX, 75703	SS.GM.T0001621	West Mud Creek	37	37	MANHOLE	DEBRIS, GREASE	No	Yes - 3/10/2021	Sewer leaking out of manhole. SS.MH.T0005481 was leaking approximately 1 gallon per minute for 37 minutes = 37 gallons into West Mud Creek. Stop was relieved from SS.MH.T0005480 by running through SS.MH.T0000318 for 397 feet. Area was flushed with 200 gallons of fresh water, and disinfected with HTH. Recovered 237 gallons of wash water, disinfectant, and sewer mixture.	Replace Sewer Main	No
3/26/2021	4:40:00 PM	3/26/2021	5:30:00 PM	Camp St & Carlyle Ave Tyler, TX 75702	SS.GM.T0005150	Blackfork Creek	150	150	MANHOLE	GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0004422 was leaking approximately 3 gallons per minute for 50 minutes = 150 gallons into storm drain. Area was flushed with 500 gallons of fresh water, and disinfected with HTH. Recovered 650 gallons of wash water, disinfectant, and sewer mixture.	Repair Sewer Main, PM Wash	No
3/29/2021	7:15:00 AM	3/29/2021	8:40:49 AM	2021 Old Omen Rd, Tyler, TX, 75701	SS.GM.T0005276	Blackfork Creek	1700	1700	MANHOLE	FATS, OIL, GREASE	No	No	Sewer leaking out of manhole. SS.MH.T0006447 was leaking approximately 20 gallons per minute for 85 minutes = 1,700 gallons into storm drain. Area was flushed with 2,000 gallons of fresh water, and disinfected with HTH. Recovered 3,700 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No
3/29/2021	9:58:00 AM	3/29/2021	11:15:00 AM	2216 S Southeast Loop 323, Tyler, TX, 75701	SS.GM.T0008928	Contained In Yard	77	77	GRAVITY MAIN	DEBRIS ROOTS	No	No	Sewer leaking out of gravity main. SS.GM.T0008928 was leaking approximately 1 gallon per minute for 77 minutes = 77 gallons into yard. Area was flushed with 1,000 gallons of fresh water, and disinfected with HTH. Recovered 1,077 gallons of wash water, disinfectant, and sewer mixture.	Place on High Frequency Cleaning list, CCTV	No

CERTIFICATION:

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering such information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including possibility of fine and imprisonment for knowing violations.


Mr. Doug Box - Interim Director of Utilities


4/14/2021
Date